


Selbsttest: Prüfung des Federkontakts „h“

S 0029

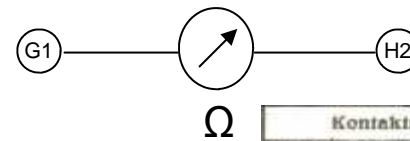

Kontaktschema W 19

	1	2	3	4	5	6	7	8	9	10	11	12	13	14
a			●	●	●	●	●	●	●	●				
b		●												
c		●												
d									●					
e												●	●	●
f												●	●	●
g										●	●	●	●	●
h									●	●	●	●	●	●
i													●	●
lc													●	●
l	●	●	●	●	●	●	●	●	●	●	●	●	●	●
m	●	●	●	●	●	●	●	●	●	●	●	●	●	●
n	●	●	●	●	●	●	●	●	●	●	●	●	●	●

Prüfanweisung

1. Gerät vom Stromnetz trennen.
2. Keine Röhre aufstecken.
3. Prüfschalter in Stellung 13 drehen.
4. Ohmmeter zwischen die Buchsen G1 und H2 schalten.
5. Messbereich 2 kOhm wählen.
6. Das Ohmmeter muss ca. 1100 Ohm anzeigen.