


## Selbsttest: Prüfung des Federkontakts „L“

S 0032

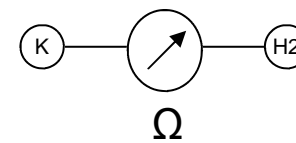

Kontaktschema W 19

	1	2	3	4	5	6	7	8	9	10	11	12	13	14
a			●	●	●	●	●	●	●	●				
b		●												
c		●												
d										●				
e													●	●
f												●	●	●
g									●	●	●	●	●	●
h									●	●	●	●	●	●
i														●
k														●
l	●	●	●	●	●	●	●	●	●	●	●	●	●	●
m		●	●	●	●	●	●	●	●	●	●	●	●	●
n		●	●	●	●	●	●	●	●	●	●	●	●	●

### Prüfanweisung

1. Gerät vom Stromnetz trennen. Keine Röhre aufstecken.
2. Prüfschalter in Stellung 2 drehen.
3. Ohmmeter zwischen die Buchsen K und H2 schalten.
4. Kleinsten Messbereich wählen.
5. Das Ohmmeter muss ca. 0,1  $\Omega$  anzeigen.