


Selbsttest: Prüfung des Federkontakts „m“

Kontaktschema W 19

	1	2	3	4	5	6	7	8	9	10	11	12	13	14
a			●	●	●	●	●	●	●	●				
b	●													
c	●													
d										●				
e												●	●	●
f													●	●
g									●	●	●	●	●	●
h									●	●	●	●	●	●
i													●	●
kc													●	●
l	●	●	●	●	●	●	●	●	●	●	●	●	●	●
m	●	●	●	●	●	●	●	●	●	●	●	●	●	●
n	●	●	●	●	●	●	●	●	●	●	●	●	●	●

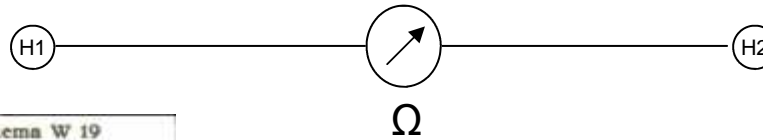

(41) (42)

Prüfanweisung

1. Gerät vom Stromnetz trennen. Keine Röhre aufstecken.
2. Prüfstifte einsetzen.
3. Prüfschalter in Stellung 3 drehen.
4. Ohmmeter zwischen die Buchsen H1 und H2 schalten.
5. Kleinsten Messbereich wählen.
6. Das Ohmmeter muss ca. 0,1 Ω anzeigen.